



RECEIVED
By Carol Day at 4:15 pm, Feb 10, 2014

DATAMASTER MAINTENANCE REPORT

REPORT #6

Complete this report at the time of the regular monthly preventive maintenance check (not to exceed 35 days).
Complete this report whenever the instrument is serviced or repaired and whenever it is placed into service.
Retain the original and send a copy within 15 days to the Breath Alcohol Program, DHSS.

DATAMASTER SN 204159 (Inv# 127276)	NAME OF AGENCY Missouri State Highway Patrol	DATE OF INSPECTION 02/06/2014
LOCATION OF INSTRUMENT (STREET AND CITY) 415 W. 3rd Street Platte City, Missouri (Platte County Detention)		TIME OF INSPECTION 3:51 pm

CHECKLIST: Place a mark in the box by each item if found to be satisfactory or if operating within established limits. (Write in observed values where determined.) Unmarked items must be corrected before using instrument.

<input checked="" type="checkbox"/> DIAGNOSTIC CHECK (PRINTOUT ATTACHED)	DATE AND TIME (from printout) 02/06/2014 15:51
<input checked="" type="checkbox"/> COMPUTER	<input checked="" type="checkbox"/> DETECTOR
<input checked="" type="checkbox"/> PROGRAM	<input checked="" type="checkbox"/> FILTERS
<input checked="" type="checkbox"/> HEATERS SAMPLE CHAMBER _____ 50 °C	<input checked="" type="checkbox"/> QUARTZ STANDARD
<input checked="" type="checkbox"/> FLOW DETECTOR	<input checked="" type="checkbox"/> CALIBRATION
<input checked="" type="checkbox"/> PUMP HIGH SPEED	<input checked="" type="checkbox"/> PRINTER

INDICATOR LIGHTS

SIMULATOR SOLUTION SUPPLIER RepCo Marketing LOT # 13001 EXP. DATE 03/07/2015

SIMULATOR TEMP (34°C ± 0.2°C) 34 °C SIMULATOR SN G11071 EXP. DATE 12/04/2014

CALIBRATION CHECK – (ONLY ONE STANDARD IS TO BE USED PER MAINTENANCE REPORT)

Run three tests using a standard solution. All three tests must be within ±5% of the standard value and must have a spread of .005 or less. Mark the box corresponding to the standard solution being used. (PRINTOUT ATTACHED)

0.100% STANDARD - MUST READ BETWEEN 0.095% AND 0.105% INCLUSIVE
 0.080% STANDARD - MUST READ BETWEEN 0.076% AND 0.084% INCLUSIVE
 0.040% STANDARD - MUST READ BETWEEN 0.038% AND 0.042% INCLUSIVE

TEST 1 .101	TEST 2 .102	TEST 3 .102
--------------	--------------	--------------

PERFORM R.F.I. TEST (PRINTOUT ATTACHED)

INDICATE THE NUMBER OF BREATH TESTS IN THE FOLLOWING RANGES SINCE THE LAST MAINTENANCE REPORT: (DO NOT INCLUDE SELF-ADMINISTERED TESTS)

REFUSALS	0	(0-.04)	0	(.05-.09)	2	(.10-.14)	2	(.15-.19)	5	OVER .19	2
----------	---	---------	---	-----------	---	-----------	---	-----------	---	----------	---

LIST ANY NEW PARTS AND DESCRIBE ANY ALTERATION OR MODIFICATION THAT WAS MADE TO RESTORE THE INSTRUMENT TO OPERATE SATISFACTORILY AND WITHIN ESTABLISHED LIMITS (USE OTHER SIDE IF NECESSARY).

Instrument is operating within DHSS specifications.

INSPECTING OFFICER	
SIGNATURE 	PRINT FULL NAME Trooper T.I. Goolsby
TYPE II PERMIT NUMBER/EXPIRATION DATE 240008 01/14/2016	TELEPHONE NUMBER (816) 622-0800

RETURN COMPLETED REPORT TO THE: Breath Alcohol Program, MO Department of Health and Senior Services, Southeast District Office
2875 James Blvd.
Poplar Bluff, MO 63901

CERTIFICATE OF ANALYSIS

MANUFACTURER AND SUPPLIER: RepCo Marketing, Inc.
LOT NUMBER: 13001
EXPIRATION DATE: March 7, 2015 at 11:59 p.m.

RepCo Marketing, Inc. certifies the following:


RepCo Marketing, Inc. manufactured, tested and supplied Lot Number 13001 of Alcohol Certified Solution for simulators. Random samples of said lot number were analyzed by an independent laboratory utilizing a gas chromatograph and found to contain .1215 gms/dl +/- .003 gms/dl wt/vol ethanol (95% Confidence).

The alcohol and distilled water used in the solution were found to be free of any interfering substance.

This solution will produce a vapor alcohol value of .100 +/- 3% gms/210L Breath when heated to 34 Degrees Celsius +/- 0.2 Degrees Celsius in a simulator (95% Confidence).

The date of manufacture for this lot number is March 8, 2013
The expiration date for this lot number is March 7, 2015 at
11:59 p.m.

This document is a true representation of the original Certificate of Analysis.



Cecil B. Garner, President
RepCo Marketing, Inc.


BAC DataMaster Evidence Ticket

MISSOURI STATE HIGHWAY PATROL
BAC DATAMASTER SERIAL NUMBER 204159
02/06/14
15:51

--- DIAGNOSTIC CHECK ---

COMPUTER: OKAY
PROGRAM (04-07-2009): OKAY
HEATERS
SAMPLE CHAMBER: 50c
FLOW DETECTOR: OKAY
PUMP
HIGH SPEED: OKAY
DETECTOR: OKAY
FILTERS: OKAY
QUARTZ STANDARD: OKAY
CALIBRATION: OKAY

PRINTER TEST
!#\$%&'()*+,-./0123456789:;<=>?@ABCDEFGHIJK
LMNOPQRSTUVWXYZ[\]^_`abcdefghijklmnop
qrstuvwxyz{|}~

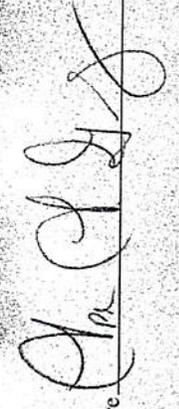

Operator Signature

BAC DataMaster Evidence Ticket


MISSOURI STATE HIGHWAY PATROL
BAC DATAMASTER SERIAL NUMBER 204159
02/06/14

TESTING OFFICER:
GOOLSBY/T/I
OFFICER I.D.: 839
PERMIT NUMBER: 240008
EXPIRATION DATE: 01/14/16
MISCELLANEOUS DATA:
.10

--- SUPERVISOR MODE ---

BLANK TEST .000 16:03
INTERNAL STANDARD VERIFIED 16:03
EXTERNAL STANDARD .101 16:03
BLANK TEST .000 16:04
EXTERNAL STANDARD .102 16:04
BLANK TEST .000 16:05
EXTERNAL STANDARD .102 16:05
BLANK TEST .000 16:06

N = 3
SIM. = .1
AVG. = .1016

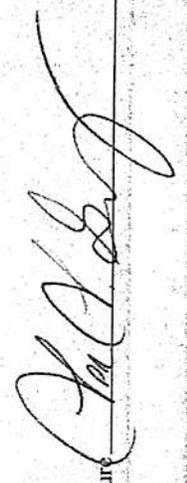

Operator Signature

Face This Side Down - This Edge In First

**BAC DataMaster
Evidence Ticket**

MISSOURI STATE HIGHWAY PATROL
BAC DATAMASTER SERIAL NUMBER 204159
02/06/14

ARREST TIME: 00:00
SUBJECT NAME:
RFI/TEST
DOB: 11/11/11 SEX: M
STATE/D.L.: MO/RFI TEST
ARRESTING OFFICER:
GOOLSBY/T/I
OFFICER I.D.: 839
TESTING OFFICER:
GOOLSBY/T/I
OFFICER I.D.: 839
PERMIT NUMBER: 240008
EXPIRATION DATE: 01/14/16
MISCELLANEOUS DATA:
RFI TEST |

--- BREATH ANALYSIS ---

BLANK TEST	.000	16:08
INTERNAL STANDARD	VERIFIED	16:08
RADIO INTERFERENCE		

Operator Signature

